

Aircraft Associates
 Notable Aircraft Maintenance History
 5/29/26

Registration	Make	Model							
N6130V	Beechcraft	1965 S35 Bonanza							
Serial No.	Engine	Paint	Interior	Tach / AFTT	MGTOV	Empty Weight	Useful Load	CG	
D-7797	IO-550-B	JetGlo Matterhorn White w/Antique Gold and Park Blue (1992)	Airtex Tan Leather Seats, Side Panels and Headliner w/Sand Carpet (2024)			3500	2320.3	1179.7	81.59
Log	Date Logged	Item(s) Addressed	Critical Item						
Airframe Log 1	March-65	STANDARD - Utility airworthiness certificate issued			0				
		Started AdLog this date. Airframe Log 1 not scanned at this							
	April-84	time.			4475.45				
	June-84	Installed GEM 602 engine monitor. See 337. Tach 500			4484				
	September-84	Installed LORAN 612 Flybrary and 3M WX10A. Tach 515			4499				
	April-85	Installed Aerox Portable Cylinder mount			4508				
		Replaced LH and RH front windows. Installed missing center flap gap seal.			4667				
	April-86	LH ruddervator reskinned. RH ruddervator stripped, treated, primed and repainted. Balanced both ruddervator assemblies. Installed doubler on stringer "c" at station 242. CW SI 2188							
	May-88	with kit 35-4016-75	Ruddervators repaired		4826				
	June-90	Repaired crack in RH side of nose wheel well.			4900				
		Aircraft stripped, corrosion treated, skin etched, alodined, and epoxy chromate primed. Colors applied: JetGlo Matterhorn							
	November-92	White, Park Blue HR10596, and Antique Gold HS10512	New Paint		5349.8				
	November-92	New tachometer installed at 1303.51 reading 0.	New tach		5398.31				
		Replaced rear cabin subfloor. Installed Aero Sound Shield							
	September-95	acoutical/thermal insulation IAW STC SA00063LA. See 337.			5670				
		Replaced RH and LH exhaust tubes. Replaced ASI with factory new. Replaced LH IB fuel cell with new from FFC. Replaced fuel crossfeed valve with new.							
	August-04		New LH fuel cell		6082				
	August-08	Installed new tach reading 0 at old tach time 866.6			6150				
	September-18	Installed new Artex 345 ELT.			6397				
Airframe Log 2	February-20	Replaced GTX320 with GTX335 WAAS transponder IAW STC SA01714W1			6419				
	October-20	Replaced LH OB wheel half with hardware and installed new tire and tube			6427				
	July-21	Installed GTN 650xi, GI 275 AI, GI 275 EIS, GI 275 ADAHRS, and GTX 345 in place of previous equipment			6459				
	July-21	Installed Beechcraft step			6460				
	March-22	Installed GFC 500 Autopilot in place of previous. See 337			6509				
		OH'd both wingtip fuel tank senders. Reinstalled tanks and senders with new hoses and hardware. Installed new retract rod boot and new Lord shimmy damper IAW STC SA00609DE.							
	April-22	See 337			6509				
		Installed BatteryMinder interface kit and WAT LED anticollision assemblies on upper and lower fuselage. Installed new Brackett air filter assembly. Installed new BAS Inertia Reel shoulder harness system for front seats IAW STC SA010855E.							
	February-23	See 337			6558				
		Replaced interior with Airtex Wall Panel Kit. Patched over previous ashtray locations. Replaced cockpit door seal.							
	January-24	Replaced headliner and carpets with new Airtex kits.	Interior refurbish		6593				
		Updated avionics software and conducted pitot/static and transponder checks			6593				
	March-24	Replaced IO-520 engine with IO-550-B IAW STC SA22005W. Installed D'Shannon Airflow Baffles and Cooling Baffles IAW STC SA04625CH.							
Engine Log	November-24	IO-550-B46B s/n 1048181 engine rebuilt by Continental.	Engine upgrade		6594				
		Installed engine on N6130V and engine baffle kit installed. Reinstalled propeller after OH at New England Propeller Service. Installed new governor, all new flexible fluid hoses. Replaced SCAT hoses with new as needed. Reinstalled existing exhaust system with new gaskets and hardware. Installed new OEM style breather tubes and ducts. Serviced with 13 qts							
	June-25	Aeroshell 100 Mineral and prelubed.	Reman engine installed		0				
Propeller Log	June-25	Reinstalled prop after OH by New England Propeller Service Inc.	Prop OH'd		0				