

# Aircraft Logbook Audit



AIRCRAFT DESCRIPTION - NOTE AIRFRAME AND ENGINE TIMES ARE APPROXIMATE										
Year	Make	Model	Registration	Serial No.	AFTT	Engine	Serial No.	MGTOV	Empty Wt	Useful Load
1966	Beechcraft	C33A	N334WS	CE-79	5,340	IO-550-B	675391	3,550	2,178	1,372
Base Color	Trim 1	Trim 2	Trim 3	Int Material						
White	Blue	Silver	9	Leather	Complete Original	5/31/27	9/30/26		I/O	Aeroshell 15W50
LOGBOOK	DATE	AFTT	CATEGORY			DETAILS				
Airframe Log 1	Jul-66	0	Airframe - Inspection			Airworthiness certificate issued for original registration, N7937M, CE-79				
	Feb-68		Airframe - Remove / Install			Installed External Power Source kit				
	May-68		Instrument - Remove / Install			Installed new radios in place of previous. See 337				
	Sep-68	272	Airframe - Remove / Install			Installed Whelen belly strobe in place of lower rotating beacon				
	Nov-68	373	Airframe - Remove / Install			Installed new glareshield				
	Jul-69	513	Instrument - Mx / Repair			Installed Bonzar radar altimeter				
	Jun-71	836	Airframe - Mx / Repair			Replaced LH wingtip leading edge with new part. Installed Whelen strobe system IAW STC SA800EA. See 337.				
	Oct-71	927	Airframe - Remove / Install			Installed new front carpet. Repaired RH main fuel tank.				
	Nov-72	1,225	Instrument - Remove / Install			Installed Mitchell Automatic Flight System Century IIB. See 337				
	May-73	1,282	Airframe - Damage			Nose cap and side cowls replaced with factory skins. Rivited ok per original				
	Jan-77	1,988	Airframe - Remove / Install			Replaced RH and LH cabin side windows. Installed new Cleveland wheels and brakes.				
	Jun-77	2,047	Airframe - Remove / Install			Installed vertical fin fairing				
	Oct-77	2,070	Airframe - Remove / Install			Replaced both LH and RH fuel cells				
	Oct-77	2,071	Airframe - Mx / Repair			Repaired RH wing tip. Installed new aileron and tip				
	Nov-77	2,071	Airframe - Remove / Install			Installed BDS tip tanks. See 337. 3300 lbs MGTOV, new W&B				
	Jan-78	2,087	Airframe - Remove / Install			Installed Brackett air filter IAW STC SA71GL. See 337				
	Oct-86	2,456	Airframe - Mx / Repair			Installed new elevator skin p/n33-61000D-H8. Painted and balance checked				
	Jun-87	2,487	Airframe - Remove / Install			Installed quick drains in tip tanks				
	Nov-88		Instrument - Remove / Install			Replaced radios, ADF, and DME with new and LORAN.				
	Apr-89	2,700	Instrument - Mx / Repair			Installed Icarus AltAlert model 3070 in previous clock position				
	Feb-90	2,805	Change - Hobbs / Tach			Replaced tach and set to current AFTT of 2805.0				
	Feb-90	2,806	Airframe - Remove / Install			Installed BDS Speedslope windshield IAW STC SA99750. Installed new LH and RH forward side windows IAW STCSA2870WE. Installed Davtron M303 OAT indicator.				
Airframe Log 2	Aug-90	2,942	Airframe - Remove / Install			Installed BDS engine crankcase breather and vacuum pump air-oil separator kit IAW STC SA2653WE. See 337.				
	Oct-90	2,978	Airframe - Remove / Install			Installed Rapco Standby Vacuum System IAW STC SA4392WP. See 337				
	Apr-91	3,053	Airframe - Remove / Install			Installed new BDS 15 gallon tip tanks. Tanks are replacements for originals				
	Oct-91	3,100	Instrument - Remove / Install			Installed KCS55A HSI				
	Dec-91	3,176	Airframe - Remove / Install			Installed Tanis PDR Door and Doubler Assembly. See 337				
	Apr-92	3,223	Airframe - Mx / Repair			CW AD 91-23-07 and SB2333 by installing SMP Upper Rudder Hinge Bracket IAW STC SA4899NM. Changes repetitive inspection to 1000 hour intervals. See 337				
	Jun-92	3,250	Airframe - Paint / Interior			Stripped and repainted in Alumingrip in the colors: Oyster White H8010, Aristo Blue G5003, and Desert Sand G6002. CW AD 91-17-01 LH painted blue, RH painted black .020 aluminum patch riveted and bonded with Hysol over a crack on leading edge of RH elevator at forward screw of torque fitting. Crack was stop-drilled.				
	Aug-92	3,285	Airframe - Remove / Install			Replaced gear motor brushes. Installed Insight Strike Finder. See 337.				
	Aug-93	3,424	Engine - Overhaul			Installed IO-550-B engine and prop in place of previous IO-520 and prop IAW STC SA2200SW which included new Lord mounts and fuel/oil hoses. OH'd prop governor, vacuum pump and air/oil separator. Replaced standby vacuum pump with new.				
	Aug-93	3,424	Instrument - Remove / Install			Installed JPI temp monitoring system IAW STC SA2586NM. See 337				
	Aug-94	3,566	Airframe - Mx / Repair			R&R LH Main fuel cell after repair. Installed new return fuel hose.				
	Aug-95	3,648	Airframe - Mx / Repair			Replaced MLG motor with OH'd unit				
	Jan-98	3,879	Instrument - Remove / Install			Removed radar altimeter and TRN70. Replaced tach with Horizon P1000 digital tach IAW SA5491NM at tach 3879.8.				
	Jan-98	3,879	Airframe - Remove / Install			Installed Rosen visors IAW STC SA3598NM. R&R RH fuel gauge. Installed altimeter, Aeroquip hoses, rebuilt LH MLG strut. Reskinned LH and RH elevators, painted and reinstalled. See 337.				
	Feb-98	3,884	Airframe - Mx / Repair			Replaced CBs for flap motor, gear lights, T&B, CHT, Aux fuel pump, Fuel Qty, Stall warning, throttle switch, gear hom, ignition, alternator, oil temp, radio, cabin lights, and cigarette lighter.				
	Feb-99	3,917	Instrument - Remove / Install			Replaced autopilot with S-TEC System 55 IAW STC SA0899AC-D. Installed GX50 GPS in place of LORAN. Installed PM3000 ICS and King KT 76C transponder. See 337				
	Sep-99	3,991	Airframe - Remove / Install			Installed Medeco Lock assemblies in cabin and baggage doors				
	Jun-00	4,015	Instrument - Remove / Install			Installed Garmin GNS530, Sandel 3308, KR87 in place of previous avionics.				

