

Aircraft Logbook Audit



AIRCRAFT DESCRIPTION - NOTE AIRFRAME AND ENGINE TIMES ARE APPROXIMATE										
Year	Make	Model	Registration	Serial No.	AFTT	Engine	SMOH	MGTOW	Empty Wt	Useful Load
1981	Beechcraft	A36	N81HB	E-1902	5,517	IO-520-BB	684850	3,600	1,620	1,980
Base Color	Trim 1	Trim 2	Trim3	Int Material		Annual Due	Pitot/Static Due			
Select	Select	Select	Select	Select	Complete Original	6/30/27	6/30/28		I/O	Phillips XC 20W50
LOGBOOK		DATE	AFTT	CATEGORY		DETAILS				
Airframe Log 1		Jul-81	2	Airframe - Inspection		STANDARD airworthiness certificate issued for E-1902/N1829F				
		May-82	32	Instrument - Remove / Install		Installed Ryan Stormscope WX-10 and KNS-81. See 337				
		Mar-83	254	Airframe - Mx / Repair		Removed vertical stabilizer and installed new one p/n 33-640000. Replaced bracket p/n 002-400440000-53 with new part. Painted temporary N numbers on both sides of fuselage. Replaced fwd wing bolt cover.				
		May-83	254	Airframe - Paint / Interior		Painted by Ohio Aviation Co in Imron colors: Brown 7502U, Orange 5080UH, Moondust.				
		May-84	471	Instrument - Remove / Install		Installed S-TEC Yaw Damper system ST-117. See 337				
		Dec-86	943	Instrument - Remove / Install		Installed SPA-400 Intercom				
		Dec-88	1,321	Airframe - Mx / Repair		Installed Beech kit 36-4003-15 s/n 737 seat track reinforcement which CW AD 88-21-02				
		Jun-91	1,752	Engine - Overhaul		Installed Gold Medallion IO-550-B engine IAW STC SA2200SW. Installed D'Shannon Wet Vacuum system and Air/Oil Separator IAW STC SA1643SO and STC SA2653. N				
		Aug-91	1,788	Airframe - Remove / Install		Installed new flap motor				
		Sep-93	2,290	Airframe - Paint / Interior		Refurbished seat faces, top side panel trim strips and recovered decorative panels. Replaced carpet.				
		Aug-93	2,290	Airframe - Paint / Interior		Aircraft stripped and repainted in Imron colors: Base White 817, Gold 44469, and Black 99U. Registration changed to N81HB.				
		Oct-93	2,313	Airframe - Remove / Install		Long range ferry tank removed and associated equipment. Surrey, UK				
Airframe Log 2		Nov-94	2,831	Airframe - Inspection		Annual inspection in Leesburg, VA. Aircraft appears to have been brought back to US. Tach 1028				
		Dec-94	2,902	Airframe - Remove / Install		Installed Tanis TAS-100 Preheater system				
		Jul-95	2,976	Airframe - Mx / Repair		Stripped, treated and refinished elevators due to corrosion.				
		Jan-96	3,003	Airframe - Remove / Install		Replaced beacon with WAT Strobe-beacon. See 337. Replaced intercom with PSE PM2000				
		Apr-97		Instrument - Remove / Install		Replaced PM2000 with PM3000 intercom				
		Mar-00	3,378	Engine - Overhaul		Installed factory OH'd IO-550 engine with new Barry mounts, magnetos, alternator, starter, oil cooler, fuel pump. Installed OH'd vacuum pump. Replaced flex fluid lines with new and baffles where needed. Replaced both mufflers with new Microcraft. Replaced Tanis heater kit with new heater parts. Installed EI UB16 engine analyzer IAW STC SA00690SE. Installed OH'd governor and BDS McCauley prop and spinner IAW STC SA1166GL. See 337				
		Oct-00	3,466	Airframe - Remove / Install		Replaced strobe beacon with K2U strobe and fin cap IAW STC SA00911CH				
		Nov-01	3,556	Airframe - Mx / Repair		Removed LH elevator due to damage to trailing edge from moving aircraft by hand. Skin replaced, painted, balanced and reinstalled.				
		Nov-02	3,652	Instrument - Remove / Install		Installed GNS 530, 430, GI 106A, PMA3000 6 place intercom in place of previous. Installed Precise Flight Vacuum System Warning Kit.				
		Dec-02	3,652	Instrument - Remove / Install		Installed PSE PXE 7500 Entertainment System				
		Mar-03	3,685	Airframe - Mx / Repair		Replaced LH elevator skin by Williams Airmotive due to dent in skin by Mid-Ohio Aviation. Damage was superficial. Replaced skin due to customer's request.				
		Apr-05	3,982	Airframe - Remove / Install		Installed Unison ignition kit K6320-32. AD 96-12-07 is no longer applicable.				
		May-06	4,074	Airframe - Mx / Repair		Cleaned corrosion, surface patched and repainted area on LH IB gear door. Replaced RH IB gear door due to corrosion and installed new MPM Inc monolithic machine RH IB gear door p/n LD-DR0001-12 IAW STC SA00902WI. See 337.				
		Jun-09	4,454	Instrument - Remove / Install		Installed L3 Skywatch 497 and Garmin GDL 69 on aft avionics shelf IAW STC SA00733CH and SA01487SE. Installed OH'd T&B indicator				
Airframe Log 3		Jun-10	4,599	Airframe - Paint / Interior		R&R'd interior seats and panels for recovering. Verified bum certs. Installed Rosen visors IAW STC SA3598NM.				
		Jun-10	4,599	Instrument - Remove / Install		Installed Shadin AMS 2000 Alt alerter and DAC GDC31 Roll steering converter IAW STC SA10236SC.				
		May-12	4,750	Engine - Overhaul		Installed 406 ELT. Installed OH'd IO-550 engine and OH'd propeller. OH'd alternator.				
		May-12	4,750	Airframe - Remove / Install		Updated W&B to reflect GW increase due to D'Shannon Cooling Air Baffle Kit IAW STC SA368CH. See 337. Tach 0 and Hobbs 1373.49.				
		Jul-12	4,780	Instrument - Remove / Install		Installed G500 Flight Display, GTX330, GMA 340 and upgraded GNS530 to GNS530W. Installed JPI EDM-930 IAW STC SA01828SE, RC Allen standby AI, and Emerging Lifesaving Technologies ELT406GPS with 406 Dual GPS antenna.				

[illegible]