

Propeller Logbook



SENSENICH PROPELLER SERVICE, INC.

McCauley



Hartzell



MT



Sensenich



Dowty



Hamilton Standard



INSTALLING AGENCY PLEASE NOTE:
Recording of Propeller Total Time Since New (TTSN)
is Required Per F.A.R. 91.417

Lancaster Airport, 519 East Airport Road, Lititz, PA 17543 (800) 462-3412 (717) 560-3711 Fax: (717) 560-4354 FAA Certified Repair Station #QV9R194N

Lee Gilmore Memorial Airport, 1142 Aviation Boulevard, Gainesville, GA 30501 (800) 791-7767 (770) 538-0444 Fax: (770) 538-0117 FAA Certified Repair Station #S46R346N

Windham County Airport, 21 Airport Road, North Windham, CT 06256 (877) 456-7944 (860) 456-7944 Fax: (860) 456-0410 FAA Certified Repair Station #Q0PR011X

Propeller Model 3A32C406-C

Blade Model G-82 NDB-2

Hub Serial No. 991762

Blade Serial No. 1 TJ 223

2 TJ 236

3 TJ 245

4

5

6

Cumberland Avionics, LLC
210 Tune Airport Drive, Nashville, Tn. 37209
(615) 350-6110

Da

N81HB Beech A36 S/N: E-1902 Tach: 2988.66 Date: 12/09/11

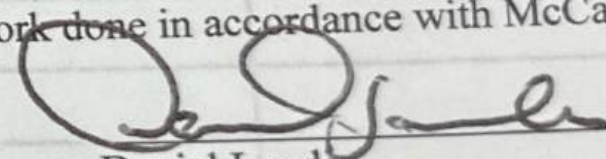
1: Removed & installed propeller to replaced front crankshaft seal, installed propeller with new o'ring p/n A1633-3 & new nuts p/n MS21044N8. Tightened & secured hardware as required. I certify that this work has been accomplished and inspected in accordance with applicable maintenance manuals and/or instructions and was determined to be in airworthy condition at this time. End.

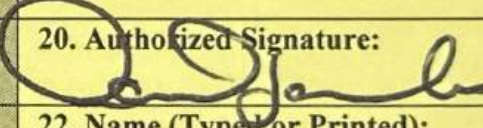

Albert T MacMillan, AP 506643185

tion

24C IT

SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures
			 Sensenich Propeller Service, Inc. 1142 Aviation Boulevard Gainesville, Ga. 30501 Phone (770)538-0444 Fax (770)538-0117 www.sensenichpropellers.com	
			Mar. 16, 2012	Work Order Number: G15902
			Propeller Model: 3A32C406-C/G-82NDB-2	Hub Serial No: 991762
			Blade S/N's: TJ223 TSN: 1372.09	TSO: -0-
			TJ236 TSN: 1372.09	TSO: -0-
			TJ245 TSN: 1372.09	TSO: -0-
			Blade Angles: Low: 13.3	High: 29.0
			Propeller TSN: 1372.09	Hub TSN: 1372.09
			Propeller TSO: -0-	
			Disassemble, Service, Magnaflux, Zyglo, Assemble, Check Track, Set Angles, Balance – Overhaul. Comply with AD 2007-08-04 Using S/B 248 As Method of Compliance. Recurs Every 100 Hours or at Annual Inspection, Whichever Occurs First (Blades and Hub are Life Limited to 10,000 Hours). All work done in accordance with McCauley Specifications.	
			 Daniel Landis Repair Station S46R346N	

1. Approving National Aviation Authority/Country: FAA / UNITED STATES		AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG				3. Form tracking Number: 12-0135	
4. Organization Name and Address: Sensenich Propeller Service, Inc 1142 Aviation Boulevard, Gainesville, Ga. 30501						5. Work Order/Contract/Invoice Number: G15902	
6. Item:	7. Description:	8. Part Number:	9. Eligibility: *	10. Quantity:	11. Serial/Batch Number	12. Status/Work:	
1	McCauley 3-Blade Propeller Assembly	3A32C406-C/ G-82NDB-2	N/A	1	991762	Overhaul	
13. Remarks: Blade S/N's: TJ223(TSN: 1372.09), TJ236(TSN: 1372.09), TJ245(TSN: 1372.09). Manuals: MPC400 R-2, SPM100 R-4 & BOM100 R-5. Comply with S/Bs Thru: 264, S/Ls Thru: 2011-5. Comply with AD 2007-08-04 Using S/B 248 As Method of Compliance. Recurs Every 100 Hours or at Annual Inspection, Whichever Occurs First (Blades and Hub are Life Limited to 10,000 Hours). All work done in accordance with McCauley Specifications. Propeller TSN: 1372.09 Propeller TSO: -0-							
14. Certifies the items above were manufactured in conformity to: ☐ Approved design data and are in condition for safe operation. ☐ Non-approved design data specified in Block 13.				19. ☒ 14 CFR 43.9 Return to Service ☐ Other regulation specified in Block 13. Certifies that unless otherwise specified in Block 13, the work identified in Block 12 and described in block 13 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.			
15. Authorized Signature:		16. Approval/Authorization No.		20. Authorized Signature:		21. Approval/Certificate No.:	
						S46R346N / EASA.145.6252	
17. Name (Typed or Printed):		18. Date (m/d/y):		22. Name (Typed or Printed):		23. Date (m/d/y):	
				Daniel Landis		Mar. 16, 2012	
USER/INSTALLER RESPONSIBILITIES							
It is important to understand the existence of this document alone does not automatically constitute authority to install the part/component/assembly. Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness accepts parts/components/assemblies from the airworthiness authority of the country specified in Block 1. Statements in Blocks 14 and 19 do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft can be flown.							

SERVICE HISTORY

[illegible]

SERVICE HISTORY

[illegible]

SERVICE HISTORY

[illegible]

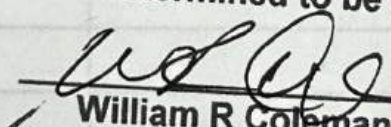
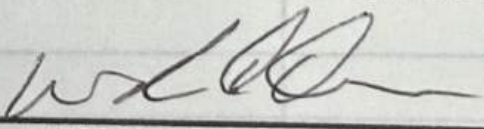
SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures
8/11/2015			Wingnuts Aviation, LLC	N31HB
Tach: 231.10			4432 Airport Road	3A32C406-C
Prop SMOH: 231.1			Springfield, TN 37172	991762
1. Complied with an annual inspection in accordance with 14 CFR (FAR) 43 Appendix D with reference to Beechcraft A36 maintenance manual. 2. Complied with AD's, through bi-weekly 2015-15. 3. Complied with AD 07-08-04 Propeller Limitations. Next due at 331.1 Tach or 12 months.				
I certify this prop has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.				
			 David Bliss	AP 3456094 IA
9/2/2016			Wingnuts Aviation, LLC	NS1HB
Tach: 338.50			4432 Airport Road	3A32C406-C
Prop SMOH: 338.5			Springfield, TN 37172	991762
1. Complied with an Annual inspection in accordance with 14CFR (FAR) 43 appendix D with reference to Beech Maintenance Manual and all applicable ICA's. 2. Complied with AD's, through bi-weekly 2016-17.				
I certify this prop has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.				
			 David Bliss	AP 3456094 IA

SERVICE HISTORY

[illegible]

SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures
Tach: 547.1		Hobbs: 5321.9 P/N 3A32C406-C 406-C	SMOH: 1523.8 546.2	
		March 3, 2021		
Completed a 100 hour inspection and inspected prop for security and general condition. Checked A.D.'s and none issued as of this date. I certify this propeller has been inspected in accordance with FAR part 43 appendix (D) 100 hr inspection and was determined to be airworthy.				
 William R Coleman A&P 2138911 IA				
B&D Aviation LLC 2424 Airport Rd Harrison, AR 72601 870-577-0678		Model: McCauley Reg No: N81HB	Model: 3A32C406 Hobbs: March 3, 2021	
Completed AD 07-08-04 IAW AD & SAIB NE-08-21/ASB248. Placard installed and no prop blade defects found.				
 William Coleman 2138911 IA				

BEVAN AVIATION, INC. 1880 S AIRPORT ROAD WICHITA, KS 67209 CRS KG2R951K
LOG ID# 10962 15-April-2022 WO# 76330 AC TT 5375.8 HOBBS 5375.8
N81HB S/N E-1902 BEECH A36

Pg 1 / 1

PERFORMED ANNUAL INSPECTION IAW FAR 43 APPENDIX (D) USING BONANZA INSPECTION FORM AS A GUIDE.
COMPLIED WITH AD 2007-08-04 BY VISUALLY INSPECTING PROPELLER BLADES FOR DAMAGE, NONE WAS NOTED.
ALL APPLICABLE AD'S CHECKED THROUGH THIS DATE.
I CERTIFY THAT THIS PROPELLER WAS INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND
WAS DETERMINED TO BE IN AIRWORTHY CONDITION. PERTINENT DETAILS OF THE MAINTENANCE PERFORMED
ARE ON FILE AT THIS REPAIR STATION UNDER W/O 76330.

Russell Parker 4-15-2022

KG2R951K RUSSELL PARKER Date

BEVAN AVIATION, INC. 1880 S AIRPORT ROAD WICHITA, KS 67209 CRS KG2R951K
LOG ID# 11607 11-April-2023 WO# 78506 AC TT 5385.3 HOBBS 5385.3
N81HB S/N E-1902 BEECH A36

Pg 1 / 1

PERFORMED ANNUAL INSPECTION IAW FAR 43 APPENDIX (D) USING BONANZA INSPECTION FORM AS A GUIDE.
COMPLIED WITH AD 2007-08-04 BY VISUALLY INSPECTING PROPELLER BLADES FOR DAMAGE, NONE WAS NOTED.
ALL APPLICABLE AD'S CHECKED THROUGH THIS DATE.
I CERTIFY THAT THIS PROPELLER WAS INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND
WAS DETERMINED TO BE IN AIRWORTHY CONDITION. PERTINENT DETAILS OF THE MAINTENANCE
PERFORMED ARE ON FILE AT THIS REPAIR STATION UNDER W/O 78506.

Russell Parker 4-11-2023

KG2R951K RUSSELL PARKER Date

BEVAN AVIATION, INC. 1880 S AIRPORT ROAD WICHITA, KS 67209 CRS KG2R951K
LOG ID# 12253 01-May-2024 WO# 80504 AC TT 5440.6 HOBBS 5440.6
N81HB S/N E-1902 BEECH A36

Pg 1 / 1

PERFORMED ANNUAL INSPECTION IAW FAR 43 APPENDIX (D) USING BONANZA INSPECTION FORM AS A GUIDE.
COMPLIED WITH AD 2007-08-04 BY VISUALLY INSPECTING PROPELLER BLADES FOR DAMAGE, NONE WAS NOTED.
ALL APPLICABLE AD'S CHECKED THROUGH THIS DATE.
I CERTIFY THAT THIS PROPELLER WAS INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND
WAS DETERMINED TO BE IN AIRWORTHY CONDITION. PERTINENT DETAILS OF THE MAINTENANCE
PERFORMED ARE ON FILE AT THIS REPAIR STATION UNDER W/O 80504.

Russell Parker 5-1-2024

KG2R951K RUSSELL PARKER Date

Authorized Signatures

Pg 1 / 1

ed Signatures

05-01-25

Date _____

[illegible]



SENENICH PROPELLER SERVICE, INC.

www.senenichpropellers.com

