

Right
HARTZELL

PROPELLER LOGBOOK

PROPELLER MODEL PHC-334F-24F/FC7663-2R.

PROPELLER S/N ED5108B

LOGBOOK # 1

Part Number: J3F00060

HARTZELL PROPELLER INC

INSPECTION

Date: 6/2/2005

Work Order #: M119030

Right

Model Number PHC-J3YF-2UF/FC7663-2R															
Ass'y Ser No. ED5108B		Hydr Unit No. NA		Bulkhead No. NA		Valve No. NA		Dome No.							
Blade 1 K21042		Blade 2 K21178		Blade 3 K21177		Blade 4		Blade 5		Blade 6					
Carton No.		Lbs.		Weight		Kilos		Height		Width		Length		Packing	
Comments:															
Deice Kit: NA															
IDS # 248 5-25-04															
Spinner Mounting Kit: A2476-9															
13.0 L.P./S.L. @ 30" Radius															
Packing Certified By: P.D.										Date: 6/2/05					

The approved design data for this propeller incorporates all changes required by applicable Airworthiness Directives.

Spinner Assembly Part No. _____


[illegible]



FAA CRS# FCPR831D
7777 N.E. Airport Way
Portland, OR 97218

DATE 11/22/2005 TAC/HM 981.8 N# 807TH Right Prop

Removed RH propeller p/n PHC-J3YF-2UF s/n 5104B and installed new spinner and spinner bulkhead assembly p/n C-3567-1P. Painted Face-side of all three blades as per Hartzell manual 133C. Reinstalled propeller as per Hartzell Manual 115N. Performed Dynamic balance of propeller to .05 IPS. As per Chadwick AS\W-9511-2 Pertinent details of the work described above are on file at this agency under **W.O.# 106490**. Aircraft is airworthy and is approved for return to service this date with respect to the work performed. **END.**

Authorized Signature:  Bruce Stephanson Flightcraft, Inc. – Portland

Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
10/14/07	281.0	H0065 1196.3	I certify This Prop Has been inspected in Accordance with An Annual Inspection and was Found in Airworthy Condition. Edon Vunrov 2219121 IA

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG. NO: N807TH
WORK ORDER: 1247

Rossi Aircraft, Inc.
Repair Station No. SRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326


DATE: 09.02.12
A/C TSN: 3447.6
PROP TT (R): 1517.2
TSPOH (R): 482.8
HOBBS: 1398.1

Right Prop Entries

Completed Annual Inspection... All AD's Reviewed through Issue: 2012-14

I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.

DATE: 09-02-12

SIGNED: 

Rossi Aircraft Inc.
Certified Repair Station No. SRSR378L

Work Order: 1247

Printed by EBis 3 (datcomedia.com)

Right Prop: Make and Model Hartzell PHC-J3YF-2UF/FC7663-1R Serial #: ED5108B

Date: 07/18/2011

Hobbs Time: 1357.7

Total Time: 442.4

Annual Inspection: I certify this prop has been inspected in accordance with an annual inspection and was found in airworthy condition.

Eldon Nimmo

Eldon Nimmo 2219121 IA

PROP MODEL (R)
PHC-J3YF-2UF
PROP S/N (R) ED5108B
REG NO N807TH
WORK ORDER 1761

Rossi Aircraft, Inc.

Repair Station No ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone 650-493-3326

DATE 10/15/13
A/C TSN 3509
PROP TT (R) 1578.6
TSPOH (R) 544.2
HOBBS 1459.5

Right Prop Entries

Completed Annual Inspection... All AD's Reviewed through Issue 2013-19

I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition



DATE 10-15-13

SIGNED *[Signature]*

Work Order 1761

Rossi Aircraft Inc.
Certified Repair Station No ZRSR378L

Printed by EBis 3 (datcomedia.com)

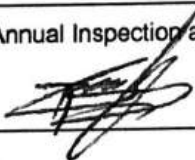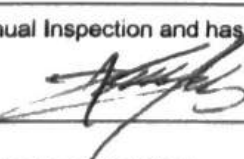Date	Propeller	A/C	Description of all operations pertaining to Airworthiness Directives, Service Bulletin, etc.	ns.
	PROP MODEL (R): PHC-J3YF-2UF PROP S/N (R): ED5108B REG. NO: N807TH WORK ORDER: 2151	Rossi Aircraft, Inc. Repair Station No. ZRSR378L 1903 Embarcadero Rd Palo Alto, CA 94303 Phone: 650-493-3326	DATE: <u>03/02/15</u> A/C TSN: 3568 PROP TT (R): 1637.6 TSPOH (R): 603.2 HOBBS: 1518.5	
	Right Prop Entries Annual Inspection - Propeller - Performed an annual inspection at Hobbs: 1519.5... All AD's Reviewed and complied with through AD Release# 2015-01			
	I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.			
	DATE: <u>03-02-15</u>	SIGNED:  Rossi Aircraft Inc. Certified Repair Station No. ZRSR378L	Work Order: 2151 Printed by EBis 3 (datcomedia.com)	
	PROP MODEL (R): PHC-J3YF-2UF PROP S/N (R): ED5108B REG. NO: N807TH WORK ORDER: 2536	Rossi Aircraft, Inc. Repair Station No. ZRSR378L 1903 Embarcadero Rd Palo Alto, CA 94303 Phone: 650-493-3326	DATE: 4/26/2016 A/C TSN: 3625.5 PROP TT (R): 1695.1 TSPOH (R): 660.7 HOBBS: 1576	
	Right Prop Entries Performed an Annual Inspection: Propeller... All AD's Reviewed and complied with through AD Release# 2016-08			
	I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.			
	DATE: 4/26/2016	SIGNED:  Rossi Aircraft Inc. Certified Repair Station No. ZRSR378L	Work Order: 2536 Printed by EBis 3 (datcomedia.com)	

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG. NO: N807TH
WORK ORDER: 2915

Rossi Aircraft, Inc.

Repair Station No. ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326

DATE: 5/22/2017
A/C TSN: 3656
PROP TT (R): 1725.6
TSPOH (R): 691.2
HOBBS: 1606.5


Right Prop Entries

Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D.... All AD's Reviewed and complied with through AD Release# 2017-11

I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.

DATE: 5/22/2017

SIGNED:

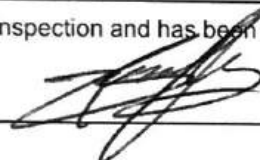

Work Order: 2915

Rossi Aircraft Inc.
Certified Repair Station No. ZRSR378L

Printed by EBis 3 (datcomedia.com)

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG. NO: N807TH
WORK ORDER: 3283

Rossi Aircraft, Inc.

Repair Station No. ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326

DATE: 7/1/2018
A/C TSN: 3696.7
PROP TT (R): 1766.3
TSPOH (R): 731.9
HOBBS: 1647.2

Right Prop Entries


Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D.... All AD's Reviewed and complied with through AD Release# 2018-06

Maintenance Release

The aircraft and/or component(s) on N807TH was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 3283, Dated 7/1/2018.

DATE: 7/1/2018

SIGNED:

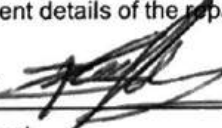

Work Order: 3283

Alberto Rossi
Certified Repair Station No. ZRSR378L

Printed by EBis 3 (datcomedia.com)

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG NO N807TH
WORK ORDER: 3634

Rossi Aircraft, Inc.

Repair Station No. ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326

DATE: 9/1/2019
A/C TSN: 3711
PROP TT (R): 1780.6
TSPOH (R): 746.2
HOBBS: 1661.5

Right Prop Entries


Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D.... All AD's Reviewed and complied with through AD Release# 2019-13

Maintenance Release

The aircraft and/or component(s) on N807TH was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 3634, Dated 9/1/2019.

DATE: 9/1/2019

SIGNED:

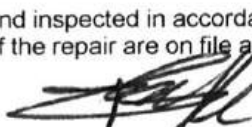

Work Order: 3634

Alberto Rossi
Certified Repair Station No. ZRSR378L

Printed by EBis 3 (datcomedia.com)

rectives,
nspections.

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG NO: N807TH
WORK ORDER: 4068

Rossi Aircraft, Inc.

Repair Station No. ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326

DATE: 10/2/2020
A/C TSN: 3749.9
PROP TT (R): 1819.5
TSPOH (R): 785.1
HOBBS: 1700.4

Right Prop Entries


Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D.... All AD's Reviewed and complied with through AD Release# 2020-19

Maintenance Release

The aircraft and/or component(s) on N807TH was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 4068, Dated 10/2/2020.

DATE: 10/2/2020

SIGNED:

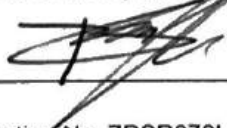

Work Order: 4068

Alberto Rossi
Certified Repair Station No. ZRSR378L

Printed by EBis 3 (datcomedia.com)

PROP MODEL (R)
PHC-J3YF-2UF
PROP S/N (R) ED5108B
REG NO N807TH
WORK ORDER 4458

Rossi Aircraft, Inc.
Repair Station No ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone 650-493-3326

DATE 1/4/2022
A/C TSN 3767 4
PROP TT (R) 1837
TSPOH (R) 802 6
HOBBS 1717 9

Right Prop Entries

Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D. All AD's Reviewed and complied with through AD Release# 2021-23

Maintenance Release

The aircraft and/or component(s) on N807TH was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service. Pertinent details of the repair are on file at this repair station under Work Order No. 4458, Dated 1/4/2022

DATE 1/4/2022

SIGNED

Alberto Rossi
Certified Repair Station No ZRSR378L

Work Order 4458

Printed by EBis 3 (datcomedia.com)

PROP MODEL (R)
PHC-J3YF-2UF
PROP S/N (R) ED5108B
REG NO N807TH
WORK ORDER 4782

Rossi Aircraft, Inc.
Repair Station No ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone 650-493-3326

DATE 4/3/2024
A/C TSN 3787 8
PROP TT (R) 1857 4
TSPOH (R) 823
HOBBS 1738 3

2 of 2

Right Prop Entries

Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D. All AD's Reviewed and complied with through AD Release# 2024-05

I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.

DATE 4/3/2024

SIGNED

Alberto Rossi
Certified Repair Station No ZRSR378L

1 of 1

Work Order 4782

Printed by EBis 3 (datcomedia.com)

Date _____

PROP MODEL (R):
PHC-J3YF-2UF
PROP S/N (R): ED5108B
REG. NO: N807TH
WORK ORDER: 5267

Rossi Aircraft, Inc.
Repair Station No. ZRSR378L
1903 Embarcadero Rd
Palo Alto, CA 94303
Phone: 650-493-3326

DATE: 5/20/2025
A/C TSN: 3798.5
PROP TT (R): 1857.4
TSPOH (R): 833.7
HOBBS: 1749

es,
tions.

Right Prop Entries

Performed and completed an Annual Inspection IAW Manufacturers MM & FAR Part 43 Appendix D.... All AD's Reviewed and complied with through AD Release# 2025-11

I Certify that this Propeller has been inspected with an Annual Inspection and has been determined to be in airworthy condition.

DATE: 5/20/2025

SIGNED:

Work Order: 5267

Alberto Rossi
Certified Repair Station No. ZRSR378 of 1

Printed by EBis 3 (datcomedia.com)

[illegible]

HARTZELL PROPELLER INC.

One Propeller Place

Piqua, Ohio 45356-2634 U.S.A.

Telephone: 937.778.4200

Telex: 4332032

Fax: 937.778.4391